[4910-13-P]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2014-0250; Directorate Identifier 2013-NM-165-AD; Amendment

39-17930; AD 2014-16-06]

RIN 2120-AA64

Airworthiness Directives; Bombardier, Inc. Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation

(DOT).

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for certain Bombardier, Inc. Model CL-600-2B16 (CL-604 Variant) airplanes. This AD was prompted by reports of in-flight uncommanded rudder movements. This AD requires revising the airplane flight manual (AFM) to incorporate an uncommanded yaw motion procedure. We are issuing this AD to prevent in-flight uncommanded rudder movements, which could lead to structural failure and subsequent loss of the airplane.

DATES: This AD becomes effective [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

ADDRESSES: You may examine the AD docket on the Internet at http://www.regulations.gov/#!docketDetail;D=FAA-2014-0250 or in person at the Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC.

For service information identified in this AD, contact Bombardier, Inc., 400

Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax
514-855-7401; email thd.crj@aero.bombardier.com; Internet

http://www.bombardier.com. You may view this referenced service information at the
FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For
information on the availability of this material at the FAA, call 425-227-1221.

FOR FURTHER INFORMATION CONTACT: Luke Walker, Aerospace Engineer,
Airframe and Mechanical Systems Branch, ANE-171, FAA, New York Aircraft
Certification Office (ACO), 1600 Stewart Avenue, Suite 410, Westbury, NY 11590;
telephone 516-228-7363; fax 516-794-5531.

SUPPLEMENTARY INFORMATION:

Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Bombardier, Inc. Model CL-600-2B16 (CL-604 Variant) airplanes. The NPRM published in the <u>Federal Register</u> on April 21, 2014 (79 FR 22069). The NPRM was prompted by reports of in-flight uncommanded rudder movements. The NPRM proposed to require revising the AFM to incorporate an

uncommanded yaw motion procedure. We are issuing this AD to prevent in-flight uncommanded rudder movements, which could lead to structural failure and subsequent loss of the airplane.

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2013-22, dated August 12, 2013 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Bombardier, Inc. Model CL-600-2B16 (CL-604 Variant) airplanes. The MCAI states:

There have been several reported incidents where Bombardier Regional Jet aeroplanes experienced in-flight uncommanded rudder movements. Investigation revealed that a failure of the voltage regulator inside the yaw damper actuator could lead to uncommanded yaw movement. If not corrected, this condition could lead to structural failure and the subsequent loss of the aeroplane.

Since the Challenger 604 aeroplanes have the same system, and can also experience a similar problem of uncommanded yaw movement, Transport Canada is issuing this [Canadian] AD that mandates the introduction of an emergency procedure to the Aeroplane Flight Manual (AFM) to address the above-mentioned unsafe condition.

You may examine the MCAI in the AD docket on the Internet at http://www.regulations.gov/#!documentDetail;D=FAA-2014-0250-0002.

Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM (79 FR 22069, April 21, 2014) or on the determination of the cost to the public.

"Contacting the Manufacturer" Paragraph in this AD

Since late 2006, we have included a standard paragraph titled "Airworthy Product" in all MCAI ADs in which the FAA develops an AD based on a foreign authority's AD.

We have become aware that some operators have misunderstood or misinterpreted the Airworthy Product paragraph to allow the owner/operator to use messages provided by the manufacturer as approval of deviations during the accomplishment of an AD-mandated action. The Airworthy Product paragraph does not approve messages or other information provided by the manufacturer for deviations to the requirements of the AD-mandated actions. The Airworthy Product paragraph only addresses the requirement to contact the manufacturer for corrective actions for the identified unsafe condition and does not cover deviations from other AD requirements. However, deviations to AD-required actions are addressed in 14 CFR 39.17, and anyone may request the approval for an alternative method of compliance to the AD-required actions using the procedures found in 14 CFR 39.19.

To address this misunderstanding and misinterpretation of the Airworthy Product paragraph, we have changed the paragraph and retitled it "Contacting the Manufacturer." This paragraph now clarifies that for any requirement in this AD to obtain corrective

actions from a manufacturer, the actions must be accomplished using a method approved by the FAA, TCCA, or Bombardier, Inc.'s TCCA Design Approval Organization (DAO).

The Contacting the Manufacturer paragraph also clarifies that, if approved by the DAO, the approval must include the DAO-authorized signature. The DAO signature indicates that the data and information contained in the document are TCCA-approved, which is also FAA-approved. Messages and other information provided by the manufacturer that do not contain the DAO-authorized signature approval are not TCCA-approved, unless TCCA directly approves the manufacturer's message or other information.

This clarification does not remove flexibility previously afforded by the Airworthy Product paragraph. Consistent with long-standing FAA policy, such flexibility was never intended for required actions. This is also consistent with the recommendation of the Airworthiness Directive Implementation Aviation Rulemaking Committee to increase flexibility in complying with ADs by identifying those actions in manufacturers' service instructions that are "Required for Compliance" with ADs. We continue to work with manufacturers to implement this recommendation. But once we determine that an action is required, any deviation from the requirement must be approved as an alternative method of compliance.

We also have decided not to include a generic reference to either the "delegated agent" or "design approval holder (DAH) with State of Design Authority design organization approval," but instead we have provided the specific delegation approval granted by the State of Design Authority for the DAH throughout this AD.

Conclusion

We reviewed the relevant data and determined that air safety and the public interest require adopting this AD with the changes described previously and minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (79 FR 22069,
 April 21, 2014) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM (79 FR 22069, April 21, 2014).

We also determined that these changes will not increase the economic burden on any operator or increase the scope of this AD.

Costs of Compliance

We estimate that this AD affects 116 airplanes of U.S. registry.

We also estimate that it will take about 1 work-hour per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour. Required parts will cost about \$0 per product. Based on these figures, we estimate the cost of this AD on U.S. operators to be \$9,860, or \$85 per product.

Authority for this Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- 1. Is not a "significant regulatory action" under Executive Order 12866;
- 2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
 - 3. Will not affect intrastate aviation in Alaska; and
- 4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

Examining the AD Docket

You may examine the AD docket on the Internet at http://www.regulations.gov/#!docketDetail;D=FAA-2014-0250; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the ADDRESSES section.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2014-16-06 Bombardier, Inc.: Amendment 39-17930. Docket No. FAA-2014-0250; Directorate Identifier 2013-NM-165-AD.

(a) Effective Date

This AD becomes effective [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

(b) Affected ADs

None.

(c) Applicability

This AD applies to Bombardier, Inc. Model CL-600-2B16 (CL-604 Variant) airplanes, certificated in any category, serial numbers (S/Ns) 5301 through 5665 inclusive, and 5701 and subsequent.

(d) Subject

Air Transport Association (ATA) of America Code 22, Autopilot System; and Code 27, Rudder Actuator.

(e) Reason

This AD was prompted by reports of in-flight uncommanded rudder movements. We are issuing this AD to prevent in-flight uncommanded rudder movements, which could lead to structural failure and subsequent loss of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Airplane Flight Manual (AFM) Revision

Within 30 days after the effective date of this AD, revise the Emergency Procedures Section of the applicable Bombardier AFM to incorporate the uncommanded yaw motion procedure specified in paragraph (g)(1) or (g)(2) of this AD, as applicable.

(1) For Model CL-600-2B16 (CL-604 Variant) airplanes having S/Ns 5301 through 5665 inclusive: Procedure 1.C., Uncommanded Yaw Motion, of Section 03-06, Automatic Flight Control System, of Chapter 3 - Emergency Procedures, of the Bombardier Challenger CL-604 AFM, PSP 604-1, Revision 89, dated July 8, 2013.

(2) For Model CL-600-2B16 (CL-604 Variant) airplanes having S/Ns 5701 and subsequent: Procedure 1.C., Uncommanded Yaw Motion, of Section 03-06, Automatic Flight Control System, of Chapter 3 - Emergency Procedures, of the Bombardier Challenger CL-605 AFM, PSP 605-1, Revision 25, dated July 8, 2013.

(h) Other FAA AD Provisions

The following provisions also apply to this AD:

- (1) Alternative Methods of Compliance (AMOCs): The Manager, FAA, New York Aircraft Certification Office (ACO), ANE-170, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the New York ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.
- (2) Contacting the Manufacturer: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, Engine and Propeller Directorate, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design

Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(i) Related Information

Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF-2013-22, dated August 12, 2013, for related information. This MCAI may be found in the AD docket on the Internet at http://www.regulations.gov/#!documentDetail;D=FAA-2014-0250-0002.

(j) Material Incorporated by Reference

- (1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.
- (2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.
- (i) Procedure 1.C., Uncommanded Yaw Motion, of Section 03-06, Automatic Flight Control System, of Chapter 3 Emergency Procedures, of the Bombardier Challenger CL-604 Airplane Flight Manual, PSP 604-1, Revision 89, dated July 8, 2013.
- (ii) Procedure 1.C., Uncommanded Yaw Motion, of Section 03-06, Automatic
 Flight Control System, of Chapter 3 Emergency Procedures, of the Bombardier
 Challenger CL-605 Airplane Flight Manual, PSP 605-1, Revision 25, dated July 8, 2013.
- (3) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax

514-855-7401; email thd.crj@aero.bombardier.com; Internet

http://www.bombardier.com.

(4) You may view this service information at the FAA, Transport Airplane

Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of

this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the

National Archives and Records Administration (NARA). For information on the

availability of this material at NARA, call 202-741-6030, or go to:

http://www.archives.gov/federal-register/cfr/ibr-locations.html.

Issued in Renton, Washington, on July 30, 2014.

Jeffrey E. Duven, Manager,

Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2014-19152 Filed 08/18/2014 at 8:45 am; Publication Date: 08/19/2014]

12